

# PROGRAMMA DI FRESATURA CON ALTI AVANZAMENTI HF



**HFM 52-422-13PC**




**HFM T25-M12PC**



**HFM 25-153-25PC**

# PROGRAMMA DI FRESATURA CON ALTI AVANZAMENTI HF


## FRESA CON ATTACCO CILINDRICO

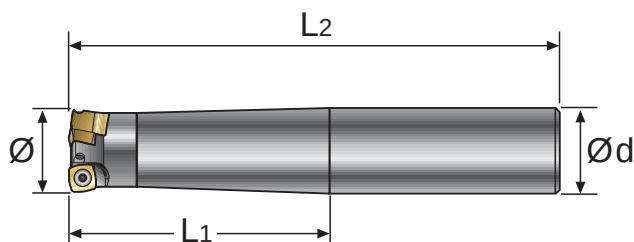

Refrigerazione centrale

| Codice Fresa   | Ø mm | Ød mm | L1 mm | L2 mm | Z | INSERTO | CHIAVE |
|----------------|------|-------|-------|-------|---|---------|--------|
| HFM25-101-25PC | 25   | 25    | 25    | 101   | 2 | SD10    | C47    |
| HFM25-127-25PC | 25   | 25    | 25    | 127   | 2 | SD10    | C47    |
| HFM25-153-25PC | 25   | 25    | 25    | 153   | 2 | SD10    | C47    |
| HFM25-203-25PC | 25   | 25    | 25    | 203   | 2 | SD10    | C47    |
| HFM32-153-32PC | 32   | 32    | 53    | 153   | 2 | SD10    | C47    |
| HFM32-203-32PC | 32   | 32    | 103   | 203   | 2 | SD10    | C47    |
| HFM32-300-32PC | 32   | 32    | 200   | 300   | 2 | SD10    | C47    |


## TESTINA CON ATTACCO FILETTATO

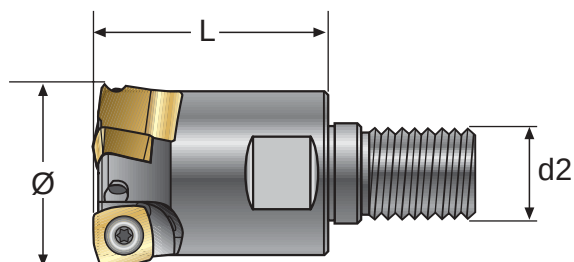

Refrigerazione sui taglienti

| Codice Fresa | Ø mm | d2 mm | L mm | Z | INSERTO | VITE |
|--------------|------|-------|------|---|---------|------|
| HFMT25-M12PC | 25   | M12   | 25   | 2 | SD10    | C47  |
| HFMT32-M16PC | 32   | M16   | 40   | 3 | SD10    | C47  |

## FRESA CON ATTACCO A MANICOTTO

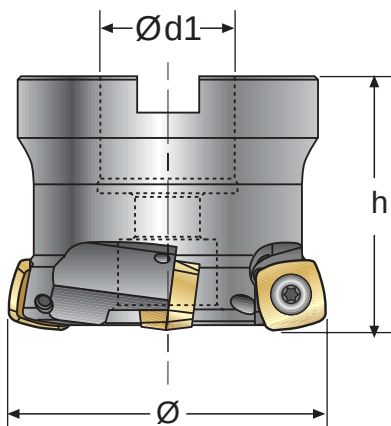

Refrigerazione sui taglienti

| Codice Fresa    | Ø mm | Ød1 mm | h mm | Z | INSERTO | VITE  |
|-----------------|------|--------|------|---|---------|-------|
| HFM52-422-13PC  | 52   | 22     | 50   | 4 | SD13    | C1032 |
| HFM63-427-13PC  | 63   | 27     | 50   | 4 | SD13    | C1032 |
| HFM63-527-13PC  | 63   | 27     | 50   | 5 | SD13    | C1032 |
| HFM80-627-13PC  | 80   | 27     | 50   | 6 | SD13    | C1032 |
| HFM100-632-16PC | 100  | 32     | 60   | 6 | SD16    | C1032 |